NO:58P4020180110

Car GPS Navigation Entertainment System



1、Mercedes Benz GLK 2013 appearance



2. Original car dashboard



from passenger's seat side



key to the right



8. Twist that discharge key



10. The plastic circle from original car keyhole plastic from original car



of original speaker

of emergency lamp





28、The original screen

which is connecting with

storage box



panel of original screen









25、With the T20 screwdriver 26、Pull out the two connectors 27、After removed the to remove 2 fixed screws from | | which are connecting with | | original screen





37. The power transfer cable from our factory



36、The GPS box

38. Take the power transfer 39. After placed the power cable through CD to screen transfer cable



55、Connect the L VDS

transfer cable

49. Put the plug in a correct

46. Connect the DVD box

power cable through the

original screen

41. Fix the velcro firmly under DVD box 42. After fixed the velcro



52、Install the CD



57、Connect all cables in

47. Install the storage box 48. Connect the our power

50. Connect all cables from 51. Connect the cable

transfer cable with original

53. Screw 2 fixed screws of 54. The L VDS transfer cable original CD

56. The screen form our

original CD



from our factory



64. Connect the connector 65. Install the original fan 66. Fix the screws of emergency lamp







67. Install the passenger's 68. Install the plastic circle





seat side panel

















from original car keyhole









5. Remove the fixed screws 6. Sepecial install/ by using T20 screw-driver




discharge key





9、Remove the plastic circle from original car

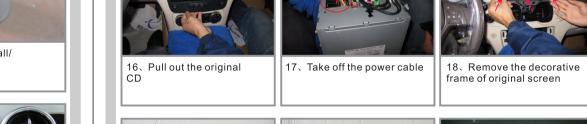

13. The Original fan

decorative plastic



19、Attention: There are 6

knobs on the decorative



front photo

20. The decorative frame

14. Loosen two front screws 15. Loosen two front screws

of original speaker

frame of original screen

decorative frame





storage box



29、Using the T20 screwdriver to remove 6 fixed screws of





40. The DVD box from our



35. After removed the



